

## Attachment I - Lead in Water Sample Results Summary

**School Name: Haddon Heights Jr./Sr. High School**

Outlet Code	Sample ID	Location/Description	Result (ppb)	Above AL?
1	39-0220-01	Room 7; sink	ND	No
2	39-0220-02	Girls restroom; sink (right)	ND	No
3	39-0220-03	Boys restroom; sink (right)	ND	No
4	39-0220-04	HS Hallway; boys restroom; water fountain	ND	No
5	39-0220-05	Nurse Office; sink	ND	No
6	39-0220-06	Ice Machine	ND	No
7	39-0220-07	Cafeterial hallway; water fountain (left)	ND	No
8	39-0220-08	Girls locker room; WF	ND	No
9	39-0220-09	Boys locker room; WF	ND	No
10	39-0220-10	Boys locker room; sink (right)	ND	No
11	39-0220-11	Fitness Center; WF	ND	No
12	39-0220-12	Room 6; sink	13.0	No
13	39-0220-13	Room 5B; sink	ND	No
14	39-0220-14	Room 5A; sink (far right)	3.8	No
15	39-0220-15	Hallway by Room 5A; WF	2.06	No
16	39-0220-16	Room A28 (CST); sink	1.79	No
17	39-0220-17	Faculty restroom; sink	ND	No
18	39-0220-18	Hallway by Guidance; WF	ND	No
19	39-0220-19	Room 10; sink (right)	ND	No
20	39-0220-20	Room 11; sink (left)	ND	No

Action Level (AL)  $\geq$ 15.5 parts per billion (ppb)

## Attachment I - Lead in Water Sample Results Summary

**School Name: Haddon Heights Jr./Sr. High School**

Outlet Code	Sample ID	Location/Description	Result (ppb)	Above AL?
21	39-0220-21	Room 12; sink (right)	ND	No
22	39-0220-22	Room 13; sink (right)	6.60	No
23	39-0220-23	Kitchen restroom; sink	1.49	No
24	39-0220-24	Kitchen sink (near freezer)	ND	No
25	39-0220-25	Kitchen sink (near ice machine	1.73	No
26	39-0220-26	Kitchen; ice machine	ND	No
27	39-0220-27	Kitchen; dishwashing sink	ND	No
28	39-0220-28	Teachers Lounge; sink	ND	No
29	39-0220-29	Room 116; sink	1.28	No
30	39-0220-30	Cafeteria; girls restroom; sink (right)	ND	No
31	39-0220-31	Cafeteria; boys restroom; sink (left)	ND	No
32	39-0220-32	Cafeteria; womens faculty restroom; sink	2.24	No
33	39-0220-33	Cafeteria; mens faculty restroom; sink	1.24	No
34	39-0220-34	Cafeteria hallway; water fountain (right)	ND	No
35	39-0220-35	Cafeteria hallway; water fountain (left)	ND	No
36	39-0220-36	Girls restroom by Room 118; sink (left)	ND	No
37	39-0220-37	Boys restroom by Room 116; sink (right)	15.4	No
38	39-0220-38	Hallway by Room 112; water fountain	ND	No
39	39-0220-39	Hallway by Room 104 water fountain	ND	No
40	39-0220-40	Mens faculty restroom by Room 149; sink	ND	No

Action Level (AL)  $\geq$ 15.5 parts per billion (ppb)

## Attachment I - Lead in Water Sample Results Summary

**School Name: Haddon Heights Jr./Sr. High School**

Outlet Code	Sample ID	Location/Description	Result (ppb)	Above AL?
41	39-0220-41	Womens faculty restroom by Room 149; sink	ND	No
42	39-0220-42	Girls restroom by Room 147; sink (left)	1.25	No
43	39-0220-43	Hallway by Room J126; water fountain	ND	No
44	39-0220-44	Room J129 prep room entrance; sink	19.1	Yes
45	39-0220-45	Mens faculty restroom; sink	1.16	No
46	39-0220-46	Womens faculty restroom; sink	2.10	No
47	39-0220-47	Boys restroom; sink (left)	ND	No
48	39-0220-48	Girls restroom; sink (right)	1.39	No
49	39-0220-49	Hallway; water fountain (left)	ND	No
50	39-0220-50	Teachers Lounge; sink	ND	No
51	39-0220-51	Hallway by Room 211; water fountain	ND	No
52	39-0220-52	Room 206; sink (right)	14.9	No
53	39-0220-53	Room 206 prep room; sink	ND	No
54	39-0220-54	Room 204; sink	1.07	No
55	39-0220-55	Room 204 chemical room/teacher; sink	13.8	No
56	39-0220-56	Room 203; sink	6.91	No
57	39-0220-57	Hallway by Room 212; water fountain	ND	No
58	39-0220-58	Room 212; sink	ND	No
59	39-0220-59	Room 201; sink	14.6	No
60	39-0220-60	Room 215; sink (left)	7.89	No

Action Level (AL)  $\geq 15.5$  parts per billion (ppb)

### Attachment I - Lead in Water Sample Results Summary

School Name: Haddon Heights Jr./Sr. High School

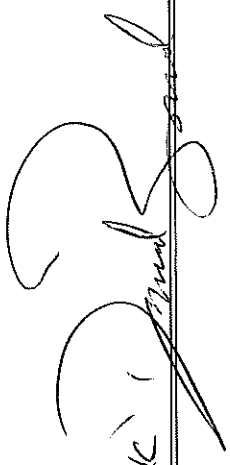
Outlet Code	Sample ID	Location/Description	Result (ppb)	Above AL?
61	39-0220-61	Room 215 Faculty restroom; sink (left)	ND	No
62	39-0220-62	Room 302; sink	2.66	No
63	39-0220-63	Room 301; sink	ND	No
64	39-0220-64	Hallway; water fountain (right)	ND	No

Action Level (AL)  $\geq$ 15.5 parts per billion (ppb)

## Attachment C - Drinking Water Outlet Inventory

School: <u>High School</u>		Address:									
Grade Levels:	Year Constructed:	1923	Year of Renovations/Additions: 2000								
Outlet Code <sup>1</sup>	Location/Description	Sample #	Operating <sup>2</sup> (Y/N)	Corrosion <sup>3</sup> (Y/N)	Filter <sup>4</sup> (Y/N)	Brass <sup>5</sup> (Y/N)	Aerator/Screen	Motion Activated	Chiller (Y/N)	Water Cooler	
										Make	Model
1	Room 7; sink	39-0220-01	X	N	N	X	X	N	N		
2	Girls restroom; sink (right)	39-0220-02	X	N	N	X	X	N	N		
3	Boys restroom; sink (right)	39-0220-03	X	N	N	X	X	N	N		
4	HS Hallway; boys restroom; water fountain	39-0220-04	X	N	N	X	N	N	N		
5	Nurse Office; sink	39-0220-05	X	N	N	X	X	N	N		
6	Ice Machine	39-0220-06	X	N	N	X	N	N	N		
7	Cafeteria hallway; water fountain (left)	39-0220-07	X	N	N	X	X	N	N		
8	Girls locker room; WF	39-0220-08	X	N	N	X	N	N	N		
9	Boys locker room; WF	39-0220-09	X	N	N	X	N	N	N		
10	Boys locker room; sink (right)	39-0220-10	X	N	N	X	X	N	N		
11	Fitness Center; WF	39-0220-11	X	N	N	X	N	N	N		
12	Room 6; sink	39-0220-12	X	N	N	X	X	N	N		
13	Room 5B; sink	39-0220-13	X	N	N	X	X	N	N		
14	Room 5A; sink (far right)	39-0220-14	X	N	N	X	X	N	N		
15	Hallway by Room 5A; WF	39-0220-15	X	N	N	X	X	N	N		
16	Room A28 (CST); sink	39-0220-16	X	N	N	X	X	N	N		
17	Faculty restroom; sink	39-0220-17	X	N	N	X	X	N	N		
18	Hallway by Guidance; WF	39-0220-18	X	N	N	X	X	N	N		
19	Room 10; sink (right)	39-0220-19	X	N	N	X	X	N	N		
20	Room 11; sink (left)	39-0220-20	X	N	N	X	X	N	N		

<sup>1</sup> Number outlets starting at the closest outlet to the Point of Entry (POE)  
<sup>2</sup> Document if permanently or temporarily out of service on the Attachment B- Plumbing Profile  
<sup>3</sup> Signs of corrosion detected, such as but not limited to leaks, rust-colored water, or stained fixtures  
<sup>4</sup> Document on Attachment D- Filter Inventory  
<sup>5</sup> Indicated if any fittings, faucets or valves are brass

Individual School Project Officer Name, Signature & Date: Mike Burgess Bill Clark  5/26/17

## Attachment C - Drinking Water Outlet Inventory

School:	<i>High School</i>		Address:								
Grade Levels:	1923	Year Constructed:	2000	Year of Renovations/Additions:	2000						
Outlet Code <sup>6</sup>	Location/Description	Sample #	Operating <sup>7</sup> (Y/N)	Corrosion <sup>8</sup> (Y/N)	Filter <sup>9</sup> (Y/N)	Brass <sup>10</sup> (Y/N)	Aerator/Screen	Motion Activated	Chiller (Y/N)	Water Cooler	
										Make	Model
21	Room 12; sink (right)	39-0220-21	X	N	N	X	X	N	N		
22	Room 13; sink (right)	39-0220-22	X	N	N	X	X	N	N		
23	Kitchen restroom; sink	39-0220-23	X	N	N	X	X	N	N		
24	Kitchen sink (near freezer)	39-0220-24	X	N	N	X	X	N	N		
25	Kitchen sink (near ice machine)	39-0220-25	X	N	N	X	X	N	N		
26	Kitchen; ice machine	39-0220-26	X	N	N	X	X	N	N		
27	Kitchen; dishwashing sink	39-0220-27	X	N	N	X	X	N	N		
28	Teachers Lounge; sink	39-0220-28	X	N	N	X	X	N	N		
29	Room 116; sink	39-0220-29	X	N	N	X	X	N	N		
30	Cafeteria; girls restroom; sink (right)	39-0220-30	X	N	N	X	X	N	N		
31	Cafeteria; boys restroom; sink (left)	39-0220-31	X	N	N	X	X	N	N		
32	Cafeteria; womens faculty restroom; sink	39-0220-32	X	N	N	X	X	N	N		
33	Cafeteria; mens faculty restroom; sink	39-0220-33	X	N	N	X	X	N	N		
34	Cafeteria hallway; water fountain (right)	39-0220-34	X	N	N	X	X	N	N		
35	Cafeteria hallway; water fountain (left)	39-0220-35	X	N	N	X	X	N	N		
36	Girls restroom by Room 118; sink (left)	39-0220-36	X	N	N	X	X	N	N		
37	Boys restroom by Room 116; sink (right)	39-0220-37	X	N	N	X	X	N	N		
38	Hallway by Room 112; water fountain	39-0220-38	X	N	N	X	X	N	N		
39	Hallway by Room 104 water fountain	39-0220-39	X	N	N	X	X	N	N		
40	Mens faculty restroom by Room 149; sink	39-0220-40	X	N	N	X	X	N	N		

<sup>6</sup> Number outlets starting at the closest outlet to the Point of Entry (POE)

<sup>7</sup> Document if permanently or temporarily out of service on the Attachment B- Plumbing Profile

<sup>8</sup> Signs of corrosion detected, such as but not limited to leaks, rust-colored water, or stained fixtures

<sup>9</sup> Document on Attachment D- Filter Inventory

<sup>10</sup> Indicated if any fittings, faucets or valves are brass

Individual School Project Officer Name, Signature & Date:

## Attachment C - Drinking Water Outlet Inventory

School:	Ash School		Address:								
Grade Levels:	1923	Year Constructed:	2000	Year of Renovations/Additions:	2000						
Outlet Code <sup>11</sup>	Location/Description	Sample #	Operating <sup>12</sup>	Corrosion <sup>13</sup>	Filter <sup>14</sup> (Y/N)	Brass <sup>15</sup> (Y/N)	Aerator/Screen	Motion Activated	Chiller (Y/N)	Water Cooler	
										Make	Model
41	Womens faculty restroom by Room 149; sink	39-0220-41	X	N	N	X	X	N	N		
42	Girls restroom by Room 147; sink (left)	39-0220-42	X	N	N	X	X	N	N		
43	Hallway by Room J126; water fountain	39-0220-43	X	N	N	X	X	N	N		
44	Room J129 prep room entrance; sink	39-0220-44	X	N	N	X	X	N	N		
45	Mens faculty restroom; sink	39-0220-45	X	N	N	X	X	N	N		
46	Womens faculty restroom; sink	39-0220-46	X	N	N	X	X	N	N		
47	Boys restroom; sink (left)	39-0220-47	X	N	N	X	X	N	N		
48	Girls restroom; sink (right)	39-0220-48	X	N	N	X	X	N	N		
49	Hallway; water fountain (left)	39-0220-49	X	N	N	X	X	N	N		
50	Teachers Lounge; sink	39-0220-50	X	N	N	X	X	N	N		
51	Hallway by Room 211; water fountain	39-0220-51	X	N	N	X	X	N	N		
52	Room 206; sink (right)	39-0220-52	X	N	N	X	X	N	N		
53	Room 206 prep room; sink	39-0220-53	X	N	N	X	X	N	N		
54	Room 204; sink	39-0220-54	X	N	N	X	X	N	N		
55	Room 204 chemical room/teacher; sink	39-0220-55	X	N	N	X	X	N	N		
56	Room 203; sink	39-0220-56	X	N	N	X	X	N	N		
57	Hallway by Room 212; water fountain	39-0220-57	X	N	N	X	X	N	N		
58	Room 212; sink	39-0220-58	X	N	N	X	X	N	N		
59	Room 201; sink	39-0220-59	X	N	N	X	X	N	N		
60	Room 215; sink (left)	39-0220-60	X	N	N	X	X	N	N		

<sup>11</sup> Number outlets starting at the closest outlet to the Point of Entry (POE)

<sup>12</sup> Document if permanently or temporarily out of service on the Attachment B- Plumbing Profile

<sup>13</sup> Signs of corrosion detected, such as but not limited to leaks, rust-colored water, or stained fixtures

<sup>14</sup> Document on Attachment D- Filter Inventory

<sup>15</sup> Indicated if any fittings, faucets or valves are brass

Individual School Project Officer Name, Signature & Date:

Attachment C - Drinking Water Outlet Inventory

School:	High School	Address:								
Grade Levels:		Year Constructed:	1923	Year of Renovations/Additions:	2000					
Outlet Code <sup>16</sup>	Location/Description	Sample #	Operating <sup>17</sup>	Corrosion <sup>18</sup>	Filter <sup>19</sup> (Y/N)	Brass <sup>20</sup> (Y/N)	Aerator/Screen	Motion Activated	Chiller (Y/N)	Water Cooler
61	Room 215 Faculty restroom; sink (left)	39-0220-61	X	N	N	X	X	N	N	
62	Room 302; sink	39-0220-62	X	N	N	X	X	N	N	
63	Room 301; sink	39-0220-63	X	N	N	X	X	N	N	
64	Hallway; water fountain (right)	39-0220-64	X	N	N	X	N	N	N	

<sup>16</sup> Number outlets starting at the closest outlet to the Point of Entry (POE)  
<sup>17</sup> Document if permanently or temporarily out of service on the Attachment B- Plumbing Profile  
<sup>18</sup> Signs of corrosion detected, such as but not limited to leaks, rust-colored water, or stained fixtures  
<sup>19</sup> Document on Attachment D- Filter Inventory  
<sup>20</sup> Indicated if any fittings, faucets or valves are brass

Individual School Project Officer Name, Signature & Date: \_\_\_\_\_